Reference Only

EMIGUARD VFR3V Series

Reference Specification

1. Scope

This reference specification applies to EMIGUARD applicable to automatic insertion, which is used electronic equipment.

2. Part Numbering

VFR3VD31E131T51BProduct IDStructureStyleFeaturesTemperature CharacteristicsRated VoltageCapacitanceLead TypePackaging CodeCode[A : Ammo Pack / B : Bulk]

Customer Part Number	Part Number	Packaging Code
	VFR3VD31E131T51B	Bulk type
	VFR3VD31E131U31A	Taping type

3. Rating

ltem	Specification
Rated Voltage	25 V(DC)
Capacitance	130 pF ± 20 %
Insulation Resistance	10 MΩ min.
Varistor Voltage	50 V(DC) ± 20 %
DC Resistance	150 Ω ± 35 %
Rated Current	20 mA(DC)
Operating Temperature	- 25 °C to + 85 °C
Storage Temperature	- 25 °C to + 85 °C

4. Standard Testing Condition

< Unless otherwise >

Temperature : Ordinary Temp. 15 °C to 35 °C Humidity : Ordinary Humidity $\,$ 25 %(RH) to 85 %(RH)

< In case of doubt >

Temperature: 20 °C ± 2 °C Humidity: 60 %(RH) to 70 %(RH) Atmospheric pressure: 86 kPa to 106 kPa

5. Style and Dimensions

Meet Item 11.

6. Marking

The following items shall be marked.

Mark of T1 Terminal : Marked as Symbol : Marked as AY.

7. Electrical Performance

No.	Item	Specification	Test Method	
7.1	Capacitance	Meet Item 3.	Measured between T1 and T2 terminal. Frequency: 1 ± 0.1 kHz Voltage: 1 ± 0.2 V(rms)	
7.2	Insulation Resistance (I.R.)		Measured between T1 and T2 terminal. Time: 30 ± 5 seconds	
7.3	Varistor Voltage		Measuring DC Current : 1 mA Regulated T1	
7.4	DC Resistance			
7.5	Temperature Characteristics (Capacitance)	within ± 20 % Capacitance shall be measured at each step specified in Table 1 after reaching thermal equilibrium. The capacitance change against the capacitance at step 3 shall be calculated. Table 1		
			Step 1 2 3 4 5 Temperature (°C) +20±2 -25± 3 +20±2 +85± 3 +20±2 +20±2	

No.	Item	Specification	Test Method
7.6	Temperature Characteristics (DC Resistance)	within ± 30 %	DC Resistance shall be measured at each step specified in Table 1 after reaching thermal equilibrium. The DC Resistance change against the DC Resistance at step 3 shall be calculated.
7.7	Withstanding Surge Current	Meet Table 2. Table 2 Appearance No damage Varistor Voltage Change within ± 10%	Waveform: 80/20 µs (rectangular pulse) Peak current: 30A The Number of Times: 2 times (5 minutes interval) Then measured after exposure in the room condition for 1 to 2 hours. Measuring varistor voltage: as same as the above surge current. Equipment of Surge test T1 T3
7.8	Pulse Life		Waveform: 150pF,330Ω ESD contact discharge. (IEC1000-4-2) Peak Voltage: 15 kV The Number of Times: 100 times (10 times/s) Then measured after exposure in the room condition for 1 to 2 hours. Measuring varistor voltage: as same as the above surge current. Electrostatic T1 Specimen T3 Output Shall be shorted

8. Mechanical Performance


No.	Item	Specification	Test Method
8.1	Appearance and Dimensions	Meet Item 5.	Visual inspection and measured with slide calipers.
8.2	Marking	Marking shall be legible	It is inspection Visually.
8.3	Solderability	Along the circumference of terminal shall be covered with new solder at least 90%.	Flux: Ethanol solution of rosin, 25(wt)% Pre-heat: 150 ± 10 °C, 60 ~ 90 seconds Solder: Sn-3.0Ag-0.5Cu Solder Temperature: 245 ± 5 °C Immersion Time: 2 ± 0.5 seconds Immersion Depth: 1.5 to 2.0 mm from the bottom of the body
8.4	Resistance to Soldering Heat	$\begin{tabular}{lll} Meet Table 3. \\ \hline \hline Table 3 \\ \hline & Appearance & No damage \\ \hline Cap.Change & within \pm 20\% \\ \hline Varistor Voltage \\ Change & within \pm 10\% \\ \hline I.R. & 10 M\Omega min. \\ \hline \end{tabular}$	Flux: Ethanol solution of rosin, 25(wt)% Pre-heat: 150 ± 10 °C, 60 ~ 90 seconds Solder: Sn-3.0Ag-0.5Cu Solder Temperature: 270 ± 5 °C Immersion Time: 3 ± 0.5 seconds Immersion Depth: 1.5 to 2.0 mm from the bottom of the body Then measured after exposure in the room condition for 1 to 12 hours.
8.5	Terminal Pull Test	Products shall be damaged.	It shall be fixed and the load shall be applied to three terminals gradually in the direction of the terminals. Applying Force: 10N Keeping Time: 10 seconds * Products should be used by being mounted through P.C.B. hole.
8.6	Terminal Bent Test		It shall be fixed and the load of 5N shall be suspended Then the body shall be bent through 90 ° and returned to its normal position. And the body shall be ben through 90 ° in the opposite direction, and returned to its normal position. * Products should be used by being mounted through P.C.B. hole.

Reference Only


9. Environment Performance

No.	Item	Specification	Test Method
9.1	Temperature Cycling	Meet Table 3.	1 Cycle 1 step: -25 ± ^o / ₃ °C / 30 minutes 2 step: Room Temperature / 5 min within.
			3 step: +85 ± 3 °C / 30 minutes 4 step: Room Temperature / 5 min within. Total of 10 cycles Then measured after exposure in the room condition for 1 to 12 hours.
9.2	Humidity		Temperature : 40 ± 2 °C Humidity : 90 to 95 %(RH)
			Time: $500 \pm {}^{2}_{0}^{4}$ hours Then measured after exposure in the room condition for 4 to 24 hours.
9.3	Humidity Load	Meet Table 4. Table 4	Temperature : 40 ± 2 °C Humidity : 90 to 95 %(RH) Test Voltage : 35 V(DC)
		Appearance No damage Cap.Change within ± 20% Varistor Voltage	Time: $500 \pm \frac{2}{0}^{4}$ hours Then measured after exposure in the room condition for 4 to 24 hours.
9.4	Heat Life	Change within ± 10% I.R. 1 MΩ min.	Temperature: 85 ± 3 °C Test Voltage: 35 V(DC)
			Time: 500 ± ½ ½ hours Then measured after exposure in the room condition for 4 to 24 hours. The voltage shall be applied between T1 and T2 terminal. Measuring direction of varistor voltage: as same as that of applied voltage.

10. Insertion Loss (Typ.)

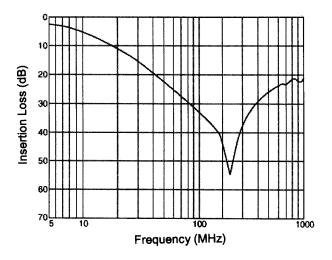


Insertion Loss measuring circuit

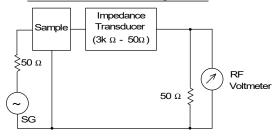


11. Style and Dimensions

11.1. Bulk (VFR3VD31E131T51B Type)

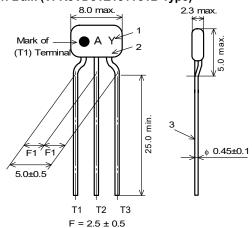

Mounting Hole

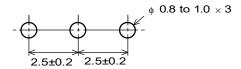



<List of MATERIAL>

	No.	ITEM	MATERIAL
1	1	Over Coating	Epoxy Resin
	2	Armor	Phenol Resin
	3	Lead Wire	Annealed Copper Wire Solder Coating

Unit Mass (Typical value) 0.23g

2.3 max

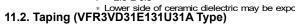

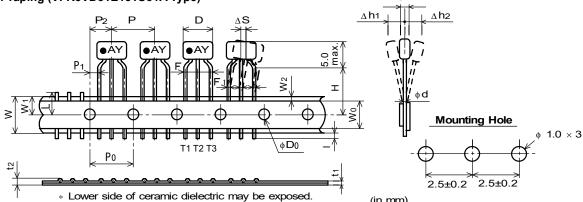


Code Description **Dimensions** Remarks Ρ Pitch of Component 12.7 Product Inclination ΔS Determines Crossing Pitch of Sprocket Hole 12.7 ± 0.2 P_0 P_1 Length from Hole Center to Lead 3.85 ± 0.7 P_2 Length from Hole Center 6.35 ± 1.3 Shift In Tape In Direction of Feed to Component Center D Width of Body 8.0 max. ΔS Deviation along tape, Left or Right 0 ± 1.0 W Carrier Tape Width 18.0 ± 0.5 $9.0 \pm {}^{0}_{0.5}$ W_1 Position of Sprocket Hole Tape Widthwise Shift + 0.5 to + 1.0 Protrusion Length Diameter of Sprocket Hole $\phi 4.0 \pm 0.1$ D_0 d Lead Diameter $\phi 0.45 \pm 0.1$ **Total Tape Thickness** 0.7 ± 0.2 t_1 Includes Thickness of Bonding Tape Total Thickness, Tape and Lead Wire 1.5 max. t_2 Deviation across Tape, front Δh1 1.0 max. Deviation across Tape, rear ∆h2 1.0 max. Portion to Cut in Case of Defect L 11.0 ± W_0 Hold Down Tape Width 12.0 ± 0.5 W_2 Hold Down Tape Position 1.5 ± 1.5 Н Lead length between sprocket hole 18.5 ± 1.0 and forming position 5.0 ± 0.8 F Lead Spacing 2.5 ± 0.4 F1


Reference Only

12. Taping

- **12.1.** A maximum of 0.3 % of the components quantity per Ammo pack may be missing without consecutive missing components.
- **12.2.** The adhesive power of the tape shall have over 2.94N at the following condition.

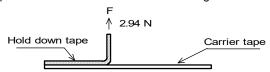


12.3. Splicing method of tape

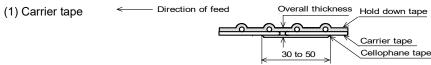

Carrier tape shall be spliced by cellophane tape.

Overall thickness shall be less than 1.05 mm. (in mm)

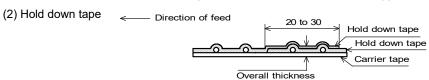

- · Hold down tape shall be spliced with overlapping.
- · Overall thickness shall be less than 1.05 mm. (in mm)
- (3) Both carrier tape and hold down tape

Both tapes shall be cut zigzag and spliced with splicing tape.

13. Packing Quantity and Packing Form

The standard packing is as follows.

(The packing quantity may be changed due to a fraction of order)


Minimum Packing From and Quantity

Terminal Configuration	A Unit Quantity Bulk : in a plastic bag Taping : in an Ammo pack	* Standard Quantity in a container (corrugated cardboard box)
VFR3VD31E131T51B (Bulk)	250 pcs.	5000 pcs.
VFR3VD31E131U31A (Taping)	2000 pcs.	20000 pcs.


* A quantity in a container is depending on a quantity of an order.

13.1. Bulk

- · A plastic bag pack
 - (1) Products are packed into a plastic bag.

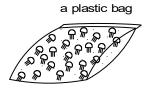

(2) The plastic bags are put into a container (corrugated cardboard box) depending on a quantity of an order.

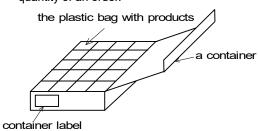


13.2. Taping

- · An ammo pack
 - (1) Folding the tape per 25 pitches, products are packed into an ammo package so that each product of each layer wound zigzag is put on top of one another.
 - (2) The dimensions of the ammo package are as follows.
 - (3) The ammo packages are put into a container (corrugated cardboard box) depending on a quantity of an order.
 - (4) Not less than 3 consecutive of component shall be missing on both edge of tape.

Spec. No. JEWE243B-0004E-01


Reference

P 6/7

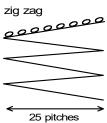

The unloading direction: Right The hold down tape: Upper



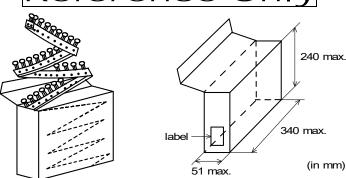

14. Marking on package

14.1. Unit package

· Bulk : Marked on plastic bag

└ · Taping : Marked on a label stuck on an ammo package.

Necessary things are printed on a unit package as follows.

Customer part number, MURATA part number, Inspection number(*1), RoHS marking (*2), Quantity, etc

*1) « Expression of Inspection No. »

0000 <u>xxx</u>

(1) Factory Code

(2) Date First digit : Year / Last digit of year

Second digit : Month / Jan. to Sep. \rightarrow 1 to 9, Oct. to Dec. \rightarrow O,N,D

Third, Fourth digit: Day

(3) Serial No.

*2) « Expression of RoHS marking »

- (1) RoHS regulation conformity parts.
- (2) MURATA classification number

14.2. Container

Stick a label on which necessary things are printed as follows.

Customer name, Purchasing Order Number, Customer Part Number, MURATA part number, RoHS marking (*2), Quantity, etc

15. /!\ Caution

15.1. Mounting holes

Mounting holes should be designed as specfied in this specifications.

Or different design from this specifications may cause cracks in ceramics which may lead to smoking / firing.

15.2. Caution for the product angle adjust work

Take care not to apply any mechanical stress to product body at the lead terminal bending process for product angle adjustment after insertion.

15.3. Limitation of Applications

Please contact us before using our products for the applications listed below which require especially high reliability for the prevention of defects which might directly cause damage to the third party's life, body or property.

(2)Aerospace equipment (3)Undersea equipment (4)Power plant control equipment (1)Aircraft equipment


(5)Medical equipment (6)Transportation equipment(automobiles,trains,ships,etc.) (7)Traffic signal equipment


(8)Disaster prevention / crime prevention equipment (10)Applications of similar complexity or with reliability requirements comparable to the applications listed in the above

16. Notice

16.1. Usage Condition

Terminal (Marked with ●) should be connected to the line of incoming electrostatic surge. (There is directional characteristics.) ·Example on output terminal ·Example on input terminal

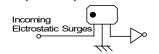

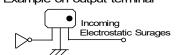

- 16.2. Products should be used at rated voltage or less and rated current or less.
- **16.3.** Products should not be applied for the absorption of surge which have large energy (ex. induced lighting surges, switching surges) because it is designed for the absorption of electrostatic surges.

16.4. Electrostatic test

Electrostatic test should be done on the following conditions.

 $n \bullet [C/R \bullet V^2]^2 < 8.0 \times 10^5$


n : Times applies C : Charging Capacitance (pF) V : Testing Voltage (kV) R : Charging Resistance (Ω)

16.5. Soldering

- (1) Flux, Solder
 - · Rosin-based flux should be used.

Do not use strong acidic flux with halide content exceeding 0.2(wt)% (chlorine conversion value.)

- · Use Sn-3.0Ag-0.5Cu solder.
- (2) Standard flow soldering profile.

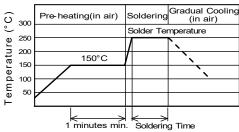

Solder Temperature	Soldering Time
250 ~ 260 °C	4 ~ 6 s

- (3) Resistance to soldering iron goes in the following condition that tip temperature is 350 °C max. and soldering time is 5 s max.
- (4) Products and the leads should not be subjected to any mechanical stress during soldering process. (and also while subjected to the equivalent high temperature.)

16.6. Cleaning

Avoid cleaning products.

16.7. Operating Environment

- (1) Do not use products in corrosive gased such as chlorine gas, acid or sulfide gas.
- (2) Do not use products in the environment where water, oil or organic solvents may adhere to products.
- (3) Do not adhere any resin to products, coat nor mold products with any resin (including adhesive) to prevent mechanical and chemical stress on products.

16.8. Storage condition

(1) Storage period

Products which inspected in MURATA over 12 months ago should be examined and used, which can be confirmed with inspection No. marked on the container.

- (2) Storage environment condition
 - Products should be storage in the warehouse on the following conditions.

Temperature : - 10 °C to + 40 °C

Humidity : 15% to 85% relative humidity No rapid change on temperature and humidity

- Don't keep products in corrosive gases such as sulfur, chlorine gas or acid, or it may cause oxidization of electrode, resulting in poor solderability.
- Products should be stored on the palette for the prevention of the influence from humidity, dust and so on.
- Products s should be stored in the warehouse without heat shock, vibration, direct sunlight and so on.
- · Products should be stored under the airtight packaged condition.
- (3) Delivery

Care should be taken when transporting or handling product to avoid excessive vibration or mechanical shock.

17. /!\ Notes

- (1) Please make sure that your product has been evaluated in view of your specifications with our product being mounted to your product.
- (2) You are requested not to use our product deviating from the reference specifications.
- (3) The contents of this reference specification are subject to change without advance notice. Please approve our product specifications or transact the approval sheet for product specifications before ordering.